



November 12, 2018

Mr. Joseph Faenza
Director of District Facilities
Palmerton Area School District
680 Fourth Street
Palmerton, PA 18071
[Email: jfaenza@palmerton.org]

RE: AHERA 6-Month Periodic Surveillance Inspection (August, 2018)
SSM File 100669.0016

Dear Mr. Faenza:

On August 13, 2018, Spotts, Stevens and McCoy (SSM), in accordance with the Environmental Protection Agency's (EPA) Asbestos Hazard Emergency Response Act (AHERA), conducted a six (6) month periodic surveillance inspection of the Palmerton Area School District building listed below.

- Palmerton Area High School

The periodic surveillance inspections were performed by David L. Kuchinski of SSM. Mr. Kuchinski is an accredited Management Planner licensed by the PA Department of Labor and Industry (copy of license attached). Enclosed is a room-by-room inventory of asbestos-containing materials (ACM) remaining in the buildings listed above. Copies of each building's report should be kept on file in each respective building, and this master copy is to be kept at a central asbestos file located within the District's main administrative office.

Mr. Kuchinski conducted room-by-room inspections of these schools in order to locate and assess changes in condition from the previous 6-month surveillance inspection. Areas where damage to ACM was observed or quantities had changed are noted in **bold type** in the room-by-room ACM inventories. SSM reminds you to maintain all asbestos abatement or management-related documentation in each building's asbestos files, and in the district central file. This is required under AHERA, and in addition, the documentation will be needed for inclusion in the next 3-year re-inspection report, which will occur in February of 2019.

Damaged ACM that was identified during the surveillance inspection in the Palmerton Area High School consisted of the following: one (1) section of fitting insulation on fiberglass insulated pipe (FGIP) located in the A115 Custodial Closet (hole in insulation). SSM also discovered damaged floor tile in the area near the Storage Room on the Stage. See the Room by Room Inventory of ACM for details on the damaged ACM. SSM reminds you that any damaged asbestos-containing materials should be repaired or removed as soon as possible as per AHERA regulations. Continue to handle all other undamaged materials under your existing Operations and Maintenance (O & M) Plan.



There were no changes in condition and/or quantity of ACM discovered during this surveillance inspection. Continue to handle existing ACM in accordance with your current Operations and Maintenance (O&M) Plan. We also remind you to continue to provide maintenance and custodial staff with annual asbestos awareness training, continue to provide annual notification to building staff, parents and guardians, and to assure that copies of all re-inspection reports and AHERA documentation are maintained in your central AHERA files **and** at each individual school (Main Office in a location that is easily accessible by office staff).

We would like to extend our thanks to you and your staff for their assistance and cooperation during the inspections. If you have any questions or comments pertaining to these inspections or reports, please feel free to call our office.

Very truly yours,
Spotts, Stevens and McCoy

A handwritten signature in black ink, appearing to read "D. L. Kuchinski", written in a cursive style.

David L. Kuchinski
Industrial Hygienist
dave.kuchinski@ssmgroup.com

Enclosure



August, 2018 AHERA 6-Month Periodic
Surveillance Inspection

Palmerton Area School District

Inspection Date: August, 2018

Issue Date: November, 2018

August, 2018 AHERA 6-Month Periodic Surveillance Inspection

Prepared for: Palmerton Area School District
Palmerton, Pennsylvania

Inspection Date: August, 2018
Issue Date: November, 2018

Prepared by: Spotts, Stevens and McCoy



David L. Kuchinski
PA Licensed Asbestos Management Planner
(#031173)

© 2018 Spotts, Stevens and McCoy

SSM File 100669.0016

**August, 2018 - AHERA 6-Month Periodic
Surveillance Inspection**

**Palmerton Area High School
3525 Fireline Road
Palmerton, PA 18071**

Prepared for:

**Palmerton Area School District
680 Fourth Street
Palmerton, PA 18071**

Prepared by:

**Spotts, Stevens and McCoy
1047 North Park Road
Reading, PA 19610
SSM File 100669.0016**

Updated by:



**David L. Kuchinski
PA Licensed Asbestos Management
Planner (#031173)**

**PALMERTON AREA SCHOOL DISTRICT
PALMERTON AREA HIGH SCHOOL
AHERA 6-MONTH PERIODIC SURVEILLANCE INSPECTION REPORT
AUGUST, 2018**

EXECUTIVE SUMMARY

The AHERA 6-Month Surveillance Inspection of the Palmerton Area High School was conducted by Mr. David L. Kuchinski on August 13, 2018. Mr. Kuchinski is an EPA AHERA accredited Building Inspector (BI), who is also licensed in the same capacity by the Pennsylvania Department of Labor and Industry (PaDLI). The surveillance inspection was performed in accordance with EPA 40 CFR, Part 763, which is commonly referred to as AHERA.

During the surveillance inspection, Mr. Kuchinski identified and assessed the condition of all known ACM, as noted in the previous inspections and re-inspections. There were no damaged materials found during this inspection. In areas where SSM could not identify ACM, as noted in the previous inspections and re-inspections, a note was added in the “comments” section of the room-by-room computer inventory.

BULK SAMPLING

There were no bulk samples collected during this surveillance inspection.

RESPONSE ACTIONS

There were no response actions taken since the previous 6-Month Surveillance Inspection.

CONCLUSION

One (1) section of fitting insulation was found to be damaged (hole in insulation) in the A-115 Custodial Closet Pipe Chase. Also, 3 S.F. of damaged and loose floor tile was discovered in the area outside the Storage Room on the Stage. There were no other changes in condition and/or quantity of ACM discovered during this re-inspection. Continue to handle existing ACM in accordance with your current Operations and Maintenance (O&M) Plan. We also remind you to continue to provide maintenance and custodial staff with annual asbestos awareness training, continue to provide annual notification to building staff, parents and guardians, and to assure that copies of all inspection reports and AHERA documentation are maintained in your central AHERA files **and** at each individual school (Main Office in a location that is easily accessible by office staff).

**PALMERTON AREA SCHOOL DISTRICT
PALMERTON AREA HIGH SCHOOL
ROOM BY ROOM INVENTORY OF ACM**

Floor	Room	Description	Quantity	LS	DC	Algorithm Values										Comments				
						E	AT	AF	PD	F	PA									
Basement	Boy's Locker Room Chase	Fitting Insulation on FGIP	14	E	1	2	1	1	2	3	2									
Basement	Above Plaster Ceiling in Boy's Locker Room	Fitting Insulation on FGIP	**	E	1	2	1	1	2	3	2								Mostly not accessible	
Basement	Back Stairwell to Boy's Locker Room	Fitting Insulation on FGIP	2	E	1	2	1	1	2	3	2								Added August 2016	
Basement	Custodial/Receiving/Storage (B102)	Fitting Insulation on FGIP	22	E	1	2	1	1	2	3	2									
Exterior	Soffits	Transite Soffit Panels	3,000	S	0	1	1	4	2	1	*								6 Sections removed Summer 2017	
First Floor	Girl's Locker Air Handler Room	Fitting Insulation on FGIP	0	E	0	0	0	0	0	0	-								2 tiles missing	
First Floor	A113 Snack Bar	9" x 9" Floor Tile	178	S	0	4	1	1	1	1	*									
First Floor	A113 Snack Bar	9" x 9" Floor Tile Mastic	180	S	0	4	1	1	1	1	*								2 visible below ceiling	
First Floor	A-115 Custodial Closet	Fitting Insulation on FGIP	3	E	1	2	1	1	2	3	2									
First Floor	A-115 Pipe Chase	Fitting Insulation on FGIP	14	E	1	2	1	1	2	3	2									
First Floor	A-115 Pipe Chase	Fitting Insulation on FGIP	1	E	1	3	1	1	2	3	2								Hole in insulation, at door to chase	
First Floor	A120	9" x 9" Floor Tile	780	S	0	4	1	1	1	1	1								130 SF removed Summer of 2016	
First Floor	A120	9" x 9" Floor Tile Mastic	780	S	0	4	1	1	1	1	*								130 SF removed Summer of 2016	
First Floor	A122	9" x 9" Floor Tile	780	S	0	4	1	1	1	1	1								130 SF removed Summer of 2016	
First Floor	A122	9" x 9" Floor Tile Mastic	780	S	0	4	1	1	1	1	*								130 SF removed Summer of 2016	
First Floor	A136 Storage	Fitting Insulation on FGIP	2	E	1	2	1	1	2	3	2									
First Floor	A138	9" x 9" Floor Tile	910	S	0	4	1	1	1	1	1									
First Floor	A138	9" x 9" Floor Tile Mastic	910	S	0	4	1	1	1	1	*									
First Floor	Library Speech Room	9" x 9" Floor Tile	200	S	0	4	1	1	1	1	1								Tiles cracked at doorway	
First Floor	Library Speech Room	9" x 9" Floor Tile Mastic	200	S	0	4	1	1	1	1	*									
First Floor	Air Handler Rooms	Fitting Insulation on FGIP	12	E	1	2	1	1	2	3	2									
First Floor	Auditorium Ceiling	Acoustical Ceiling Plaster	4,950	S	1	3	2	1	2	3	*									
First Floor	Auditorium Ceiling	Acoustical Ceiling Plaster	30	S	2	3	2	1	2	3	*									Evidence of repaired damage
First Floor	B106	Fitting Insulation on FGIP	11	E	1	2	1	1	2	3	2								5 in mezz. 6 at heater fan unit	
First Floor	B108	Fitting Insulation on FGIP	0	E	0	0	0	0	0	0	-								18 Sections removed Summer 2017	
First Floor	B109-Art	9" x 9" Floor Tile	1,300	S	0	4	1	1	1	1	1								Few gouges	
First Floor	B109-Art	9" x 9" Floor Tile Mastic	1,300	S	0	4	1	1	1	1	*									
First Floor	B109-Art	Fitting Insulation on FGIP	15	E	1	2	1	1	2	3	2								6 Sections added August 2016	
First Floor	B114 Custodian Closet	Fitting Insulation on FGIP	3	E	1	2	1	1	2	3	2									
First Floor	B117	9" x 9" Floor Tile	798	S	0	4	1	1	1	1	1								110 SF Removed Summer 2016	
First Floor	B117	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	*								110 SF Removed Summer 2016	
First Floor	B117	9" x 9" Floor Tile	6	S	2	4	1	1	1	1	1								Broken tiles, should be removed	
First Floor	B119	9" x 9" Floor Tile	50	S	0	4	1	1	1	1	1								50 SF removed Summer 2016	
First Floor	B119	9" x 9" Floor Tile Mastic	100	S	0	4	1	1	1	1	*								50 SF removed Summer 2016	
First Floor	B119	Fitting Insulation on FGIP	2	E	1	2	1	1	2	3	2									
First Floor	B126	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1								110 SF Removed Summer 2016	
First Floor	B126	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	*								110 SF Removed Summer 2016	
First Floor	B127	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1								110 SF Removed Summer 2016	
First Floor	B127	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	*								110 SF Removed Summer 2016	
First Floor	B129 ISS	9" x 9" Floor Tile	450	S	0	4	1	1	1	1	1								110 SF Removed Summer 2016	
First Floor	B129 ISS	9" x 9" Floor Tile Mastic	450	S	0	4	1	1	1	1	1								110 SF Removed Summer 2016	

FGIP = Fiberglass Insulated Pipe

* Assumed to contain asbestos

BOLD= Changes in quantity or condition since previous inspection, or damaged ACM (DC-3 or greater)

**PALMERTON AREA SCHOOL DISTRICT
PALMERTON AREA HIGH SCHOOL
ROOM BY ROOM INVENTORY OF ACM**

Floor	Room	Description	Quantity	LS	Algorithm Values										Comments		
					DC	E	AT	AF	PD	F	PA						
First Floor	B129 ISS	Fitting Insulation on FGIP	8	E	1	2	1	1	1	2	3	2	1	2	3	2	Formerly called Faculty Room
First Floor	B130	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
First Floor	B130	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
First Floor	B134 Satellite Room	9" x 9" Floor Tile	250	S	0	4	1	1	1	1	1	1	1	1	1	1	Under carpet
First Floor	B134 Satellite Room	9" x 9" Floor Tile Mastic	250	S	0	4	1	1	1	1	1	1	1	1	1	*	Under carpet
First Floor	B136/138	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
First Floor	B136/138	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
First Floor	B140	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
First Floor	B140	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
First Floor	B143	9" x 9" Floor Tile	600	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
First Floor	B143	9" x 9" Floor Tile Mastic	600	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
First Floor	Pipe Chase at Room B143	Fitting Insulation on FGIP	1	E	1	2	1	1	1	2	3	2	1	2	3	2	Added August 2016
First Floor	Corridor	Fitting Insulation on FGIP	140	E	1	2	1	1	1	2	3	2	1	2	3	2	
First Floor	Gymnasium	Fitting Insulation on FGIP	0	E	0	0	0	0	0	0	0	0	0	0	0	0	37 sections removed Summer 2017
First Floor	Health Room/A108	9" x 9" Floor Tile	988	S	0	4	1	1	1	1	1	1	1	1	1	1	Some under carpet, cracks
First Floor	Health Room/A108	9" x 9" Floor Tile Mastic	988	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Incinerator Room	Fitting Insulation on FGIP	7	E	1	2	1	1	1	2	3	2	1	2	3	2	
First Floor	Instrument Storage	9" x 9" Floor Tile	300	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Instrument Storage	9" x 9" Floor Tile Mastic	300	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Main Office-Old Athletic Dir. Room	9" x 9" Floor Tile	80	S	0	4	1	1	1	2	1	1	1	2	1	1	
First Floor	Main Office	9" x 9" Floor Tile	2,130	S	0	4	1	1	1	1	1	1	1	1	1	1	Some Under carpet
First Floor	Main Office	9" x 9" Floor Tile Mastic	2,130	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Music Room	9" x 9" Floor Tile	1,225	S	0	4	1	1	1	1	1	1	1	1	1	1	Under carpet
First Floor	Music Room	9" x 9" Floor Tile Mastic	1,225	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Music Storage Hallway	9" x 9" Floor Tile	437	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Music Storage Hallway	9" x 9" Floor Tile	3	S	2	4	1	1	1	1	1	1	1	1	1	1	Missing & broken-by incinerator door
First Floor	Music Storage Hallway	9" x 9" Floor Tile Mastic	240	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Music Storage Room	9" x 9" Floor Tile	400	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Music Storage Room	9" x 9" Floor Tile Mastic	400	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Music Storage Room	9" x 9" Floor Tile	200	S	0	4	1	1	1	1	1	1	1	1	1	1	Some Under carpet
First Floor	Music Offices (2)	9" x 9" Floor Tile Mastic	200	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Music Offices (2)	9" x 9" Floor Tile	385	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Kitchen Storage	9" x 9" Floor Tile	15	S	2	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Kitchen Storage	9" x 9" Floor Tile Mastic	400	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Kitchen Storage	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	Under carpet
First Floor	Practice Rooms	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Practice Rooms	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Receiving/Storage Room	Fitting Insulation on FGIP	28	E	1	2	1	1	1	2	3	2	1	2	3	2	
First Floor	Auditorium (middle seat section)	9" x 9" Floor Tile	120	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Auditorium (middle seat section)	9" x 9" Floor Tile Mastic	120	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Stage, Right Side	9" x 9" Floor Tile	158	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Stage, Right Side	9" x 9" Floor Tile	3	S	2	4	1	1	1	1	1	1	1	1	1	1	Missing tiles

FGIP = Fiberglass Insulated Pipe

* Assumed to contain asbestos

BOLD= Changes in quantity or condition since previous inspection, or damaged ACM (DC-3 or greater)

PALMERTON AREA SCHOOL DISTRICT
PALMERTON AREA HIGH SCHOOL
ROOM BY ROOM INVENTORY OF ACM

Floor	Room	Description	Quantity	LS	Algorithm Values										Comments		
					DC	E	AT	AF	PD	F	PA						
First Floor	Stage, Right Side	9" x 9" Floor Tile Mastic	162	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Stage, Left Side	9" x 9" Floor Tile	158	S	0	4	1	1	1	1	1	1	1	1	1	1	
First Floor	Stage, Left Side	9" x 9" Floor Tile	6	S	2	4	1	1	1	1	1	1	1	1	1	1	Missing tiles, some damage
First Floor	Stage, Left Side	9" x 9" Floor Tile Mastic	162	S	0	4	1	1	1	1	1	1	1	1	1	*	
First Floor	Stage, Left Side	Fitting Insulation on FGIP	2	E	1	2	1	1	1	2	3	2	3	2	2	2	
First Floor	Storage Above Auditorium	Fitting Insulation on FGIP	2	E	1	2	1	1	1	2	3	2	3	2	2	2	
First Floor	Storage Next to Stage (right)	Fitting Insulation on FGIP	14	E	1	4	2	1	1	3	3	2	3	2	2		
First Floor	Women's Faculty Bathroom at 129	9" x 9" Floor Tile	60	S	0	4	1	1	1	1	1	1	1	1	1	1	Loose tiles, cracks
First Floor	Women's Faculty Bathroom at 129	9" x 9" Floor Tile Mastic	60	S	0	4	1	1	1	1	1	1	1	1	1	*	
Second Floor	Custodial Room (B214)	Fitting Insulation on FGIP	1	E	1	2	1	1	1	2	3	2	3	2	2	2	under sink
Second Floor	B217 Closet	9"x9" Floor Tile	10	S	0	4	1	1	1	1	1	1	1	1	1	*	
Second Floor	B217 Closet	9"x9" Floor Tile Mastic	10	S	0	4	1	1	1	1	1	1	1	1	1	*	
Second Floor	B219	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
Second Floor	B219	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
Second Floor	B227	9" x 9" Floor Tile	546	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
Second Floor	B227	9" x 9" Floor Tile Mastic	700	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
Second Floor	B229	9" x 9" Floor Tile	310	S	0	4	1	1	1	1	1	1	1	1	1	1	
Second Floor	B229	9" x 9" Floor Tile	2	S	2	4	1	1	1	1	1	1	1	1	1	1	Cracks and gouges in tiles
Second Floor	B229	9" x 9" Floor Tile Mastic	312	S	0	4	1	1	1	1	1	1	1	1	1	*	
Second Floor	B230	9" x 9" Floor Tile	0	S	0	0	0	0	0	0	0	0	0	0	0	0	250 SF replaced by new 1'x1' tile
Second Floor	B230	9" x 9" Floor Tile Mastic	0	S	0	0	0	0	0	0	0	0	0	0	0	0	Assumed to be Removed
Second Floor	B233	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
Second Floor	B233	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
Second Floor	B234	Transite Furne Hood Panels	100	S	0	1	1	4	2	1	1	1	1	1	1	*	
Second Floor	B237	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
Second Floor	B237	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
Second Floor	B240	9" x 9" Floor Tile	0	S	0	0	0	0	0	0	0	0	0	0	0	0	878 SF Removed Summer 2017
Second Floor	B240	9" x 9" Floor Tile Mastic	878	S	0	4	1	1	1	1	1	1	1	1	1	*	
Second Floor	B240 Lab Storage	9" x 9" Floor Tile	0	S	0	0	0	0	0	0	0	0	0	0	0	0	144 SF Removed Summer 2017
Second Floor	B240 Lab Storage	9" x 9" Floor Tile Mastic	144	S	0	4	1	1	1	1	1	1	1	1	1	*	
Second Floor	B241	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
Second Floor	B241	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
Second Floor	B243	9" x 9" Floor Tile	800	S	0	4	1	1	1	1	1	1	1	1	1	1	110 SF Removed Summer 2016
Second Floor	B243	9" x 9" Floor Tile Mastic	800	S	0	4	1	1	1	1	1	1	1	1	1	*	110 SF Removed Summer 2016
Throughout	Throughout	Black Board/Tack Board Mastic	**	S	0	0	0	0	0	1	1	0	1	0	0	*	**= Not quantified, assumed
Throughout	In walls and above plaster ceilings	Fitting Insulation on FGIP	**	E	1	2	1	1	1	2	3	2	3	2	3	2	**= Not quantified
Throughout	Throughout Classrooms	Transite Window Sills	**	E	1	2	1	1	1	2	3	2	3	2	3	*	Assumed, added February 2016

FGIP = Fiberglass Insulated Pipe
* Assumed to contain asbestos
BOLD= Changes in quantity or condition since previous inspection, or damaged ACM (DC-3 or greater)

Algorithm Values


ALGORITHM VALUES - SHORT FORM

- Damaged Condition (DC) - 0 Intact, Encapsulated
1 Intact, Minor Water Stain
2 Intact, Cover Poor, Moderate Stain, No Damage
3 Minor Damage, Scrapes, etc., Duct Tape Repair
5 Damage, Fix with Patch, Repair and Encapsulate
7 Significant Damage, Some Removal Needed
10 Very Significant Damage, Removal Mandated
- Exposure Factor (E) - 0 Inaccessible or Non-friable
1 Very Limited Access
2 Maintenance Area Like Boiler Room or Above 2x4's
3 Public Area, 10 Feet and Higher
4 Public Area, 10 Feet and Lower
- Activity Level (AT) - 0 Behind Walls, Locked Closet, etc.
1 Low or Medium Usage (1-3 Persons, 8 Hr/Day)
2 #1 with Vibration or Public Area
4 High Activity (Gym, Loading Dock) and/or High Vibration
- Air Flow Factor (AF) - 0 No Impingement, Little or No Air Flow
1 Low Air Flow or Air Velocity, No Impingement
2 Air Stains, Moderate Velocity, Piston Effect
4 High Air Velocity, Air Erosion
- Potential Damage (PD) - 0 No ACM
1 ACM, No Potential Damage
2 Possible Potential Damage
3 Potential Damage Expected
4 Possible Significant Potential Damage
5 Significant Potential Damage Expected
- Friability (F) - 1 Non-Friable, Behind Walls, etc.
2 Encapsulated, Ceiling Tile, Hard Surface
3 Friable - Standard ACM and Fittings
5 Highly Friable - Delaminating, "Fluffy" Fireproofing
- Percent Asbestos (PA) - 0 = No ACM
1 = >1% but <25% - Chrysotile Only
2 = 25% to 80% - Chrysotile Only
3 = >80% - or any percentage of amosite, crocidolite, anthophyllite, tremolite or actinolite
- Linear Feet (L) - Refers to quantity of ACM
Square Feet (S) L Linear Feet
S Square Feet

Accreditations

PENNSYLVANIA ASBESTOS CERTIFICATION

031173

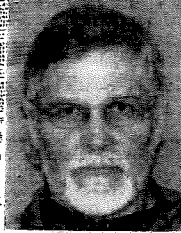

Sex	Height	Eyes	Birth Date
M	6'05"	HZL	09/06/1965

Expires	Issue Date
01/03/2019	01/26/2018

Class
MANAGEMENT PLANNER

DAVID L. KUCHINSKI
402 W. WYOMISSING BLVD
WEST LAWN PA 19609

David L. Kuchinski



SPOTTS | STEVENS | MCCOY

ssmgroup.com

READING

1047 North Park Road; PO Box 6307

Reading PA 19610-0307

P. 610.621.2000 | F. 610.621.2001

LEHIGH VALLEY

Roma Corporate Center

1605 North Cedar Crest Boulevard; Suite 106

Allentown PA 18104

P. 610.849.9700 | F. 610.621.2001

LANCASTER

701 Creekside Lane

Lititz PA 17543

P. 717.568.2678 | F. 610.621.2001